



Private Vehicle Inspection Report

Decal Number: FT09687
Decal Expiry Date: 2023-Aug-31
Inspection Number: 20203391

Inspection Result:
PASS

Facility: J. KAM AUTO REPAIR LTD. / S6203
Inspector: Dhaliwal, Jarnail Singh / 105512
Work Order Number: 58994

Inspection Type: Complete
Inspection Class: Class 1 - Light Vehicle with LGW 5500 kg or less
Inspection Reason: Salvage Vehicle

Inspection Start Date/Time: 2022-Jul-28 02:00 PM
Inspection Complete Date/Time: 2022-Aug-06 12:10 PM
Collision Repair Facility: RED SEAL COLLISION LTD
Collision Repair Facility Phone: (604) 753-8571
Collision Repair Technician: Mahmoud Haghmohammadi 01351-AB-08

Vehicle Jurisdiction: British Columbia
Registration Number: 13404020
VIN: 1C6SRFJM6LN245709
Plate Number: N/A
Licenced GVW (kg): 3675
Vehicle Year: 2020
Make: RAM

Brake Type: Hydraulic
Fuel Type: Diesel
Odometer: 51726 KM
Hub Odometer:
Body Style: Crewcab
Model:

Owner/Lessee Name: IN LINE, IN LINE MOTORS
Address: 333 - 12 ST
City: New Westminster
Province/State: British Columbia
Postal Code/ZIP: V3M4H5
Country: Canada

	Result	Comment
Vehicle Identification (VIN)	Passed	
Section 1 - Power Train	Passed	
Section 2 - Suspension	Passed	
Section 3 - Brake System	Passed	
Section 3H - Hydraulic Brakes	Passed	
Section 4 - Steering	Passed	
Section 5 - Instruments and Auxiliary Equipment	Passed	
Section 6 - Lamps	Passed	
Section 7 - Electrical System	Passed	
Section 8 - Frame and Body	Repaired (same day)	Rplod rt tail lts, burnd mouldings, cosmetic, door handles, sanded rt side & paint
Section 9A - Tires	Passed	
Section 9B - Wheels	Passed	
Section 10 - Coupling Devices	Not Applicable	
Section 11 - Other Vehicle Components	Not Applicable	

Tire Tread Depth (mm)					
Axles (front)	Outer Left	Inner left	Inner Right	Outer Right	Steering Axle?
1	2.3			2.3	✓
2	2.3			2.3	
Comment:					

Brake Lining/Pad Measurement (mm)			
Axles (front)	Lining/Pad	Left	Right
1	Pad	6	6
2	Pad	7	7
Comment:			

Rotor Thickness or Drum Inside Diameter Measurement (mm)			
Axles (front)	Rotor/Drum	Left	Right
1	Rotor	30.87	30.87
2	Rotor	21.52	21.52
Comment:			

Inspection Comments: Repaired by MJAbodyshop (604-767-1933) insp by j kam auto repair (604-691-1531)

Has this Vehicle been road tested? Yes When? Before and After Inspection Name of the person who did the road test: J Dhaliwal

Inspector Name: Dhaliwal, Jarnail Singh

Signature:

This Inspection Report was submitted to CVSE on 2022-Aug-06 12:53 PM

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/MP at the Commercial Vehicle Safety Enforcement

CVSE0013

8/6/2022 12:53:52 PM



Body Integrity Inspection Report

To be completed by the Designated Inspection Facility's Authorized Vehicle Inspector

Designated Inspection Facility Information

Designated Inspection Facility Number S 6 2 0 3

Authorized Inspector Number 1 0 5 5 1 2

DIF Facility Name J. Kam Auto Repair LTD.

Inspector Name Jarnail S. Dhaliwal

Inspection Start Date 28 07 2022 Inspection Completion Date 06 08 2022

Inspector Signature [Signature]

VEHICLE OWNER

NAME OF REBUILDER (if other than owner)

Name INLINE MOTOR

Name M.J.A AUTO BODY

Address 333 - TWELFTH ST

Address 107-13112-84 AVE

City NEW WESTMINSTER Prov BC PC V3M4H5

City SURREY Prov BC PC V3W1Z2

Tel # 604-767-1933

Tel # 604-767-1932

Vehicle Information

TYPE OF VEHICLE: Passenger Car MPV Truck Motorhome Taxi Bus

Licence Plate N1H Odometer 051726 Year 2020 Make RAM Model 1500

Registration Number 13404020 VIN/Serial # 1C6SRFJM6LN245709

I am satisfied that this rebuilt motor vehicle is the same as the one described in the record of rebuilding. Yes No

Table with columns: Requirements of Rebuilding, Components, R, C, VIM Reference Section, Components, R, C, VIM Reference Section. Rows include Strut, Hinge (A) Pillar, Centre (B) Pillar, Lock (C) Pillar, Rocker Panel, Rear Strut Tower, Bumpers, Crossmember, Hood, Rad Support, Body, Frame, Bulkhead, Doors, Quarter Panels, Floor Pan.

Rebuilt at Kam LTR, Burned Mouldings, Cosmetics at SINE sanded & painted at SINE

I certify that this rebuilt vehicle meets all Structural integrity requirements as defined in the Motor Vehicle Act Regulations and the BC Vehicle Inspection Manual.

Authorized Inspector Name (print) Jarnail S. Dhaliwal

Signature [Signature]



BRITISH COLUMBIA

Ministry of Transportation and Infrastructure

Designated Inspection Facility

(DIF must issue this form for completion by an autobody technician)

Structural Integrity Declaration Report

Commercial Vehicle Safety and Enforcement Branch

PASS All requirements met

FAIL Requirements NOT met

Designated Inspection Facility Information

Designated Inspection Facility Number: S 6 2 0 3

Facility Name: J. Kam Auto Repair LTD

Authorized Inspector Number: 1 0 5 5 1 2

Inspector Name: Jarnail S. Dhaliwal

Inspector Signature: [Signature]

Date: 06/AUG/2022 Decal No.: FT 09687

Vehicle Information

Owner INLINE MOTOR

Registration # 13404020 Plate # N/A

Address 333 - TWELFTH ST

VIN # 1C6SRFJM6LN245709

City NEW WESTMINSTER Prov BC PC V3M4N5 Make RAM Model 1500 Year 2020

Structural Integrity Declaration Report

Repair Standard and Vehicles Dimensions

1. I confirm that the repair / rebuild process for this vehicle has met or exceeded the rebuilding standards specified by the Inter-Industry Conference On Auto Collision Repair (I-CAR) and / or the Original Equipment Manufacturer (OEM), that the unitized vehicle body repair, including engine cradle, conforms to the OEM dimension standards and that a full-framed vehicle complies with the OEM, I-CAR repair standard.

Wheel alignment (all 4 wheels- attach printout) Alignment performed (facility name and address if other than above):
NAME: J. Kam Auto Repair LTD

ADDRESS: 217 12745 78 avenue

Please indicate numbers and measurements on diagram below:

From inside vehicle:	Front Left	Front Right
-0.20°	Camber	Camber 0.35°
3.6°	Caster	Caster 3.6°
0.00°	Toe	Toe 0.09°
12.5°	SAI	SAI 12.5°
12.3°	Included Angle	Included Angle 12.1°
	Turning Angle	Turning Angle

Occupant Protection and Vehicle Components

2. I confirm that the assembly of body components have been performed in a manner that provides occupant protection that is equal to or exceeding OEM or I-CAR standards.

3. I confirm that the repairable structural components of the vehicle body have been assembled and repaired in accordance with methods, procedures and standards that will return the components to its original standard, quality and properties in accordance with the OEM, I-CAR standards.

4. I confirm that the assembly joints of the vehicle body are located in places and repaired in accordance with the OEM, I-CAR procedures and standards.

Wheel Alignment

5. I confirm that a four-wheel alignment has been performed and that steering angles and wheel tolerances are within the OEM, requirements for this vehicle. A four-wheel alignment computer printout has been included as part of this declaration.

	Rear Left	Rear Right
-0.60°	Camber	Camber -0.30°
	Caster	Caster
0.28°	Toe	Toe 0.24
	SAI	SAI

I certify that this vehicle has been repaired in accordance with OEM/I-CAR standards as noted in items 1 - 5 above.

Technician Name please print Mahmoud Haghmohammadi

ALIGNMENT PASS FAIL

Autobody Tech Trade Qualification # 01351-AB-08

Date Rebuilt Completed 06/AUG/2022

Autobody Tech Trade Jurisdiction B.C 604-753-8571

Rebuilder Name (if different from technician) M-J-A AUTO BODY

Technician Signature [Signature]

Rebuilder Address 107-13712 - BVA AVE GURREY BC V3W1L2

* The ORIGINAL copy of this form must be forwarded to the designated inspection facility indicated above, and MUST be retained by the facility.
* This form must be the authentic original version signed by the autobody technician. Any photocopied, modified, altered, or changed form is unacceptable and must be rejected.
* A photocopy must accompany the customer's copy of the Vehicle Inspection Report (CVSE0013).

J KAM AUTOMOTIVE
 #217 12745 78AVE
 SURREY, BC
 604.591.1531

Customer: INLINE

License No:

Order No.:

Date: 08/06/2022 11:00


Company:

Odometer: 51726


VIN: 1C6SRFJM6LN245709


Technician:


Vehicle RAM 2020 1500 PICKUP (DS) 2WD

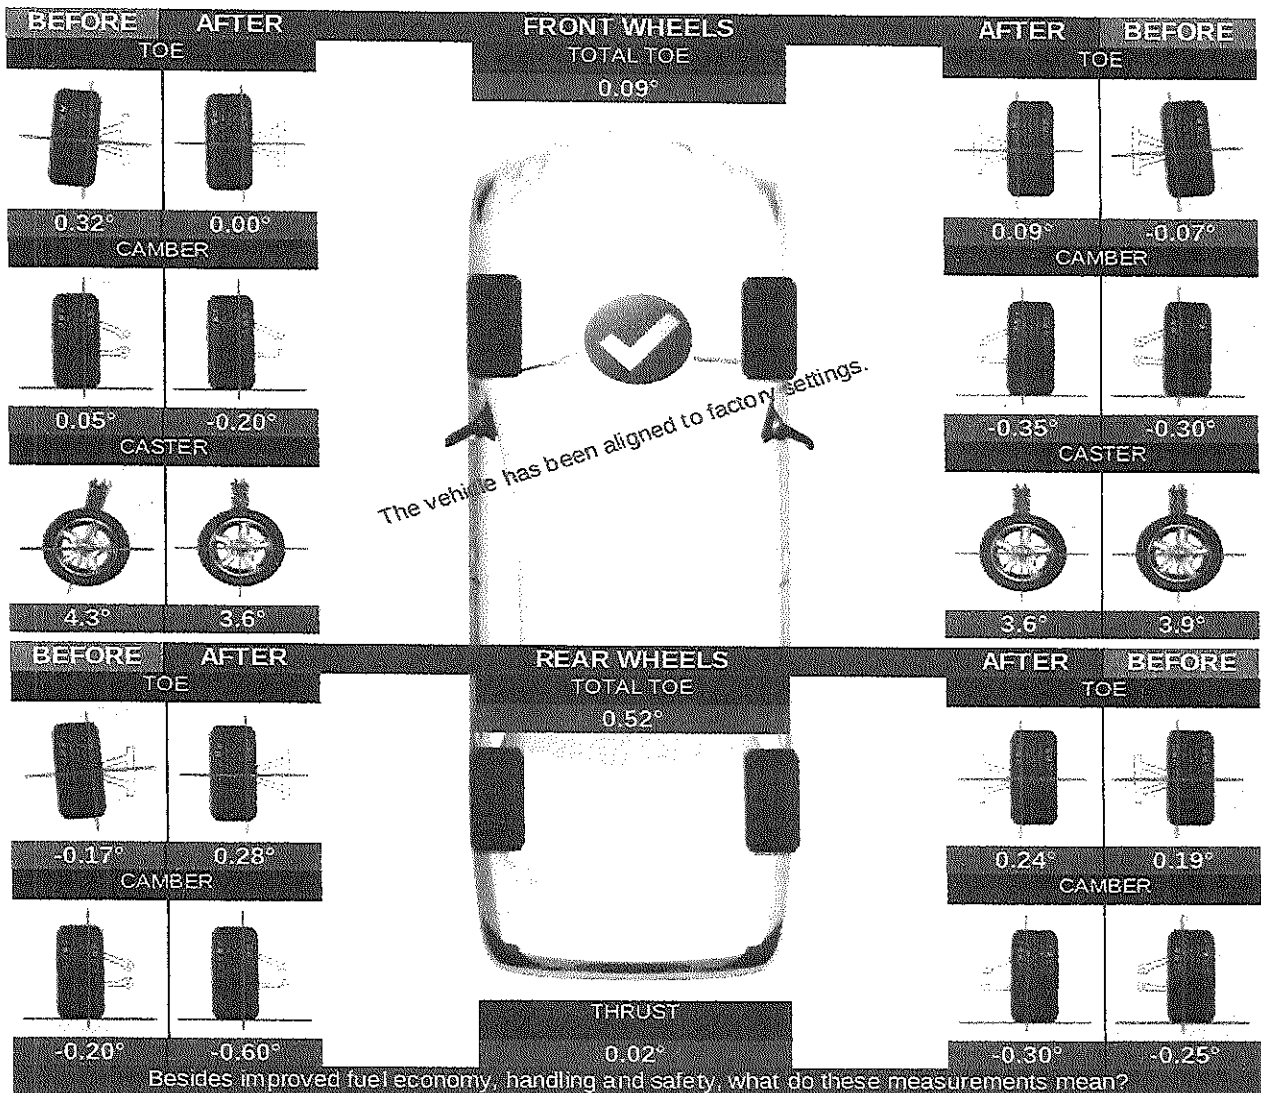

Besides improved fuel economy, handling and safety, what do these measurements mean?

 **CASTER** is the tilt of the axis that the wheel steers around. It affects how the vehicle tracks as you drive down the road and can affect handling.

 **CAMBER** is the angle of the tire in relation to the road surface. It affects tire wear, and handling when turning.

 **TOE** is a measurement of how much the wheel is turned in or out from a straight-ahead position. It affects tire wear, handling and can make your steering wheel crooked.

Your vehicle has been aligned using a precision **JohnBean** wheel aligner.

4.4.2, United States Domestic, US2021R2