



Private Vehicle Inspection Report

Decal Number: FW43631
 Decal Expiry Date: 2024-Jan-31
 Inspection Number: 20381889

Inspection Result:
PASS

Facility: J. KAMAUTO REPAIR LTD. / S6203	Inspection Type: Complete	Inspection Start Date/Time: 2023-Jan-13 11:20 AM
Inspector: Dhaliwal, Jarnail Singh / 105512	Inspection Class: Class 1 - Light Vehicle with LGVW 5500 kg or less	Inspection Complete Date/Time: 2023-Jan-19 08:00 AM
Work Order Number: 58283	Inspection Reason: Salvage Vehicle	Collision Repair Facility: RED SEAL COLLISION LTD
		Collision Repair Facility Phone: (604) 753-8571
		Collision Repair Technician: Mahmoud Haghmohammadi
		01351-AB-08

Vehicle Jurisdiction: British Columbia	Brake Type: Hydraulic	Owner/Lessee Name: INLINE, INLINE MOTORS
Registration Number: 13979563	Fuel Type: Gasoline	Address: 333 - 12 ST
VIN: 3N1CP5CV5NL498514	Odometer: 21060 KM	City: New Westminster
Plate Number: N/A	Hub Odometer:	Province/State: British Columbia
Licensed GVW (kg): 0	Body Style: 4 Door Stationwagon	Postal Code/ZIP: V3M4H5
Vehicle Year: 2022	Model: KICKS	Country: Canada
Make: NISSAN		

	Result	Comment
Vehicle Identification (VIN)	Passed	
Section 1 - Power Train	Passed	
Section 2 - Suspension	Passed	
Section 3 - Brake System	Passed	
Section 3H - Hydraulic Brakes	Passed	
Section 4 - Steering	Passed	
Section 5 - Instruments and Auxiliary Equipment	Passed	
Section 6 - Lamps	Passed	
Section 7 - Electrical System	Passed	
Section 8 - Frame and Body	Repaired (same day)	Rplcd dr door
Section 9A - Tires	Passed	
Section 9B - Wheels	Passed	
Section 10 - Coupling Devices	Not Applicable	
Section 11 - Other Vehicle Components	Not Applicable	

Axles (front)	Outer Left	Inner Left	Inner Right	Outer Right	Steering Axle?
1	4			4	✓
2	4			4	

Comment:

Axles (front)	Lining/Pad	Left	Right
1	Pad	7	7
2	Pad	7	7

Comment:

Axles (front)	Rotor/Drum	Left	Right
1	Rotor	25.54	25.54
2	Rotor	9.44	9.44

Comment:

Inspection Comments: Repaired by MJA Body Shop (778-325-5000) insp by j kam auto repair (604-591-1531)

Has this Vehicle been road tested? Yes When? Before and After Inspection Name of the person who did the road test: J Dhaliwal

Inspector Name: Dhaliwal, Jarnail Singh Signature:

This Inspection Report was submitted to CVSE on 2023-Jan-19 01:45 PM

The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/MIP at the Commercial Vehicle Safety Enforcement

CVSE0013

1/19/2023 1:45:51 PM



BRITISH COLUMBIA

Ministry of Transportation and Infrastructure

Designated Inspection Facility

(DIF must issue this form for completion by an autobody technician)

Structural Integrity Declaration Report

Commercial Vehicle Safety and Enforcement Branch

PASS All requirements met

FAIL Requirements NOT met

Designated Inspection Facility Information

Designated Inspection Facility Number: S 6 2 0 3

Facility Name: J. Kam Auto Repair LTD

Authorized Inspector Number: 1 0 5 5 1 2

Inspector Name: Jarnail S. Dhaliwal

Inspector Signature: [Signature]

Date: 19/JAN/2023 Decal No.: FW43631

Vehicle Information

Owner INLINE MOTORS

Registration # 13979563 Plate # N/A

Address 333 - 12TH ST

VIN # 3N1CP5CV5NL498514

City NEW WESTMINSTER Prov BC PC V3M4H5 Make NISSAN Model KICKS Year 2022

Structural Integrity Declaration Report

Repair Standard and Vehicles Dimensions

1. I confirm that the repair / rebuild process for this vehicle has met or exceeded the rebuilding standards specified by the Inter-Industry Conference On Auto Collision Repair (I-CAR) and / or the Original Equipment Manufacturer (OEM), that the unitized vehicle body repair, including engine cradle, conforms to the OEM dimension standards and that a full-framed vehicle complies with the OEM, I-CAR repair standard.

Wheel alignment (all 4 wheels- attach printout) Alignment performed (facility name and address if other than above):
NAME: J. Kam Auto Repair LTD

ADDRESS: 217 12745 78 avenue

Please indicate numbers and measurements on diagram below:

From inside vehicle:		Front Left	Front Right
-0.25°	Camber		Camber -0.15°
6.1°	Caster		Caster 6.0°
0.10°	Toe		Toe 0.05°
13.6°	SAI		SAI 13.7°
13.3°	Included Angle		Included Angle 13.5°
	Turning Angle		Turning Angle

Occupant Protection and Vehicle Components

2. I confirm that the assembly of body components have been performed in a manner that provides occupant protection that is equal to or exceeding OEM or I-CAR standards.

3. I confirm that the repairable structural components of the vehicle body have been assembled and repaired in accordance with methods, procedures and standards that will return the components to its original standard, quality and properties in accordance with the OEM, I-CAR standards.

4. I confirm that the assembly joints of the vehicle body are located in places and repaired in accordance with the OEM, I-CAR procedures and standards.

Wheel Alignment

5. I confirm that a four-wheel alignment has been performed and that steering angles and wheel tolerances are within the OEM, requirements for this vehicle. A four-wheel alignment computer printout has been included as part of this declaration.

		Rear Left	Rear Right
-1.40°	Camber		Camber -1.45°
	Caster		Caster
-0.10°	Toe		Toe -0.05°
	SAI		SAI

I certify that this vehicle has been repaired in accordance with OEM/I-CAR standards as noted in Items 1 - 5 above.

Technician Name please print Mahmoud Haghmohammadi

ALIGNMENT PASS FAIL

Autobody Tech Trade Qualification # 01351-AB-08

Date Rebuilt Completed 19/JAN/2023

Autobody Tech Trade Jurisdiction B.C 604-753-8571

Rebuilder Name (if different from technician) M.J.A AUTO BODY

Technician Signature

Rebuilder Address 107-13112-64 AVE SURREY BC V3W1L2

- * The ORIGINAL copy of this form must be forwarded to the designated inspection facility indicated above, and MUST be retained by the facility.
- * This form must be the authentic original version signed by the autobody technician. Any photocopied, modified, altered, or changed form is unacceptable and must be rejected.
- * A photocopy must accompany the customer's copy of the Vehicle Inspection Report (CVSE0013).



Body Integrity Inspection Report

To be completed by the Designated Inspection Facility's Authorized Vehicle Inspector

Designated Inspection Facility Information

Designated Inspection Facility Number S 6 2 0 3

Authorized Inspector Number 1 0 5 5 1 2

DIF Facility Name J. Kam Auto Repair LTD.

Inspector Name Jarnail S. Dhaliwal

Inspection Start Date 13 01 2023 Inspection Completion Date 19 01 2023

Inspector Signature [Signature]

VEHICLE OWNER

NAME OF REBUILDER (if other than owner)

Name INLINE MOTORS

Name M.J.A. AUTO BODY

Address 333-12 TH ST

Address 107-13112-84 AVE

City NEW WESTMINSTER Prov BC PCV3M4H5

City SURREY Prov BC PC V3W1L2

Tel # 778-325-5000

Tel # 778-325-5000

Vehicle Information

TYPE OF VEHICLE: Passenger Car MPV Truck Motorhome Taxi Bus

Licence Plate N/A Odometer 021060 Year 2022 Make NISSAN Model KICKS

Registration Number 13979563 VIN/Serial # 3N1CP5CV5NL498514

I am satisfied that this rebuilt motor vehicle is the same as the one described in the record of rebuilding. Yes No

Table with 10 columns: Requirements of Rebuilding, Components, R, C, VIM Reference Section, Components, R, C, VIM Reference Section. Rows include Strut, Hinge (A) Pillar, Centre (B) Pillar, Lock (C) Pillar, Rocker Panel, Rear Strut Tower, Bumpers, Crossmember, Hood, Rad Support, Body, Frame, Bulkhead, Doors, Quarter Panels, Floor Pan.

Rejected on door "R" marked when item rejected "C" marked when item corrected

FW 43631

I certify that this rebuilt vehicle meets all Structural Integrity requirements as defined in the Motor Vehicle Act Regulations and the BC Vehicle Inspection Manual.

Authorized Inspector Name (print) Jarnail S. Dhaliwal Signature [Signature]

J KAM AUTOMOTIVE
 #217 12745 78AVE
 SURREY, BC
 604.591.1531

Customer: MJA

License No:

Order No.:

Date: 01/19/2023 11:53

Company:


Odometer: 021060

VIN:


Technician: JK


3N1CP5CV5NL498514


Vehicle NISSAN 2021 KICKS 205/55 R17

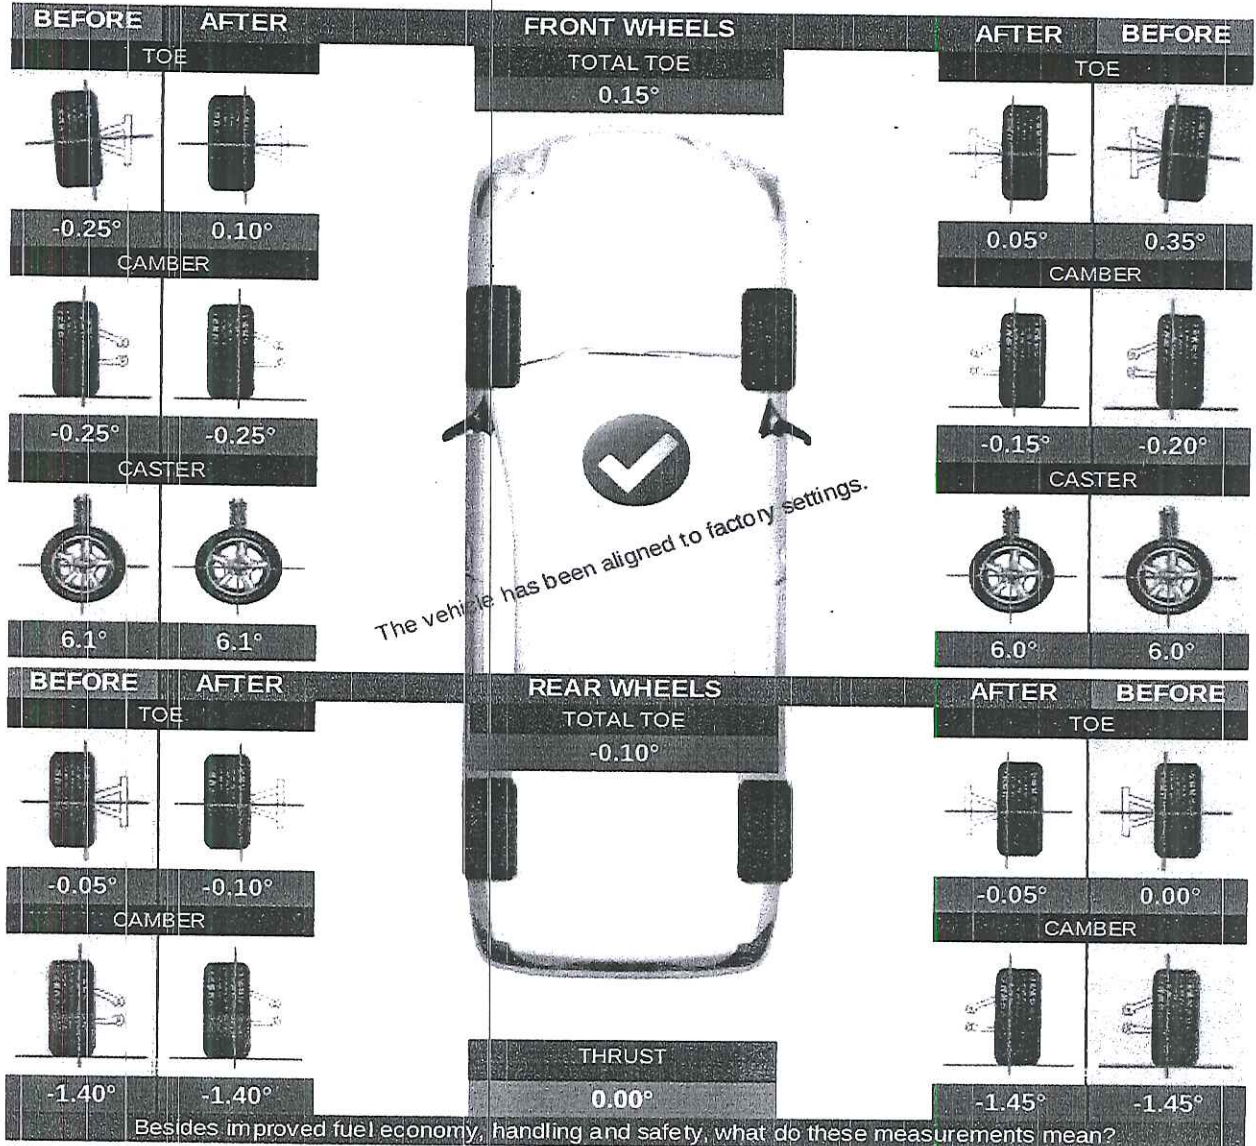

Besides improved fuel economy, handling and safety, what do these measurements mean?

 CASTER is the tilt of the axis that the wheel steers around. It affects how the vehicle tracks as you drive down the road and can affect handling.

 CAMBER is the angle of the tire in relation to the road surface. It affects tire wear, and handling when turning.

 TOE is a measurement of how much the wheel is turned in or out from a straight-ahead position. It affects tire wear, handling and can make your steering wheel crooked.

Your vehicle has been aligned using a precision  wheel aligner

* * * Communication Result Report (Jan. 19, 2023 4:43PM) * * *

1)
2)

Date/Time: Jan. 19, 2023 4:41PM

File No. Mode	Destination	Pg(s)	Result	Page Not Sent
0251 Memory TX	ICBC	P. 2	OK	

Reason for error

m. 1) Hang up or line fail	E. 2) Busy
m. 2) No answer	E. 4) No facsimile connection
m. 3) Exceeded max. E-mail size	E. 6) Destination does not support IP-Fax

BRITISH COLUMBIA Private Vehicle Inspection Report

Vehicle Identification: JLRKADU12N2VW12023
 Inspector: Doreen Janet Singh / 9252
 Inspection Type: Complete
 Inspection Class: Class 1 - Light Vehicle with Low Weight
 Inspection Reason: Safety Vehicle
 Report Generated Date/Time: 2023-Jan-19 11:00 AM
 Inspection Overdue Date/Time: 2023-Jan-19 23:59 AM
 Vehicle Registration: BCIC 8243 2023 BCIC LTD
 Vehicle Make/Model: 2023 JLRKADU12N2VW12023
 License Plate: 2023
 License Type: 2023
 Name: NISBY

Vehicle Details: 2023 JLRKADU12N2VW12023
 Registration: BCIC 8243 2023 BCIC LTD
 VIN: JLRKADU12N2VW12023
 Make/Model: 2023 JLRKADU12N2VW12023
 License Plate: 2023
 License Type: 2023
 Name: NISBY

Item	Result	Comments
Section 1 - General	Passed	
Section 2 - Brakes	Passed	
Section 3 - Steering	Passed	
Section 4 - Lights	Passed	
Section 5 - Tires	Passed	
Section 6 - Windows and Glass	Passed	
Section 7 - Mirrors	Passed	
Section 8 - Horn and Bell	Passed	
Section 9 - Bumper	Passed	
Section 10 - Clipping Device	Not Applicable	
Section 11 - Other Vehicle Components	Not Applicable	

Wheel	Outer Left	Inner Left	Inner Right	Outer Right	Steering Axle?
1	2			4	
2	4			4	

Wheel	Left	Right	Wheel	Left	Right
1	7	7	1	23.84	23.84
2	7	7	2	24.4	24.4

Inspection Comments: Reported by NISBY (2023-01-19) (reg. by class and inspection) (2023-01-19)
 Inspector Name: Doreen Janet Singh
 Signature: [Signature]

This inspection report was submitted to ICBC on 2023 Jan 19 11:00 AM
 The inspector's signature above is certified that this vehicle has been inspected in accordance with the requirements of the Motor Vehicle Act and Regulations.
NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.
 The information contained on this form is not to be used as a substitute for the summary of section 210 of the Motor Vehicle Act and Division 23 of the Motor Vehicle Act and Regulations. It is intended for the purpose of showing how well the vehicle and the driver are meeting the Motor Vehicle Act and Regulations. It is not intended to be used as a basis for determining the vehicle's fitness to be driven. For more information, please refer to the Motor Vehicle Act and Regulations.
 ICBC 8243
 1/19/2023 14:01 PM